

# AVIONICS MAINTENANCE RECORDS

(including transponder biennial checks)

Log No. A

Aircraft Registration No. N4104FP

Aircraft Manufacturer Columbia Aircraft Mfg.

Model LC42-550FG

Serial No. 42513

## EQUIPMENT LISTING


List all installed avionics, autopilot and flight director equipment.

	Mfg.	Model	Serial No.
1.			
2.			
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
13.			
14.			
15.			
16.			
17.			
18.			
19.			
20.			



**AEROTECH PUBLICATIONS INC.**

www.adlog.com  
PO BOX 1359 / SOUTHOLD, NY 11971-0965  
(631) 765-9375  
1-800-235-6444  
FAX: (631) 765-9359

DATE	AIRFRAME TIME IN SERVICE	AVIONICS TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
9-7-06	2.9	2.9	 <p>The Garmin GTX 33 Mode S Transponder, S/N 89100428 was tested as required by FAR 91.413, and was found to comply with FAR Part 43 Appendix F.</p> <p><i>[Signature]</i> M-1227 Authorized Signature for Columbia Aircraft Mfg.</p>
10-12-06	13.0	13.0	updated Garmin Nav data cycle 0610. <i>[Signature]</i>
10-25-06			updated Garmin Nav data cycle 0611. <i>[Signature]</i>
11-21-06	13.1	13.1	updated Garmin Nav data cycle 0612. <i>[Signature]</i>
12-20-06	13.1	13.1	updated Garmin Nav data cycle 0613. <i>[Signature]</i>

WESTERN AVIONICS, INC. 19711 CAMPUS DR. HANGAR A SANTA ANA, CA 92707 YH3R997L  
 LOG ID# 1356 13-September-2007 WO# 218921 REF# 218921  
 N104FP S/N 42513 COLUMBIA LC42-550FG Pg 1/1

INSPECTED AUTOPILOT SERVO MOUNTS IAW COLUMN (A) OF GARMIN SERVICE BULLETIN #0713, REVISION D DATED 6-13-07.

GSM 85 011-00894-10 SN - 88000363 (PITCH)  
 GSM 85 011-00894-00 SN - 66500376 (ROLL)

*[Signature]* 9/13/07  
 Signed YH3R997L STAN ERICKSON Date

DATE	AIRFRAME TIME IN SERVICE	AVIONICS TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
			<p>WESTERN AVIONICS, INC. 19711 CAMPUS DR. HANGAR A SANTA ANA, CA 92707 YH3R997L                  LOG ID# 1525 12-May-2008 WO# 220853 REF# 220853                  N104FP S/N 42513 COLUMBIA LC42-550FG TACH 433.1 Pg 1/1</p> <p>REMOVED DEFECTIVE GARMIN GDU 1040 P/N 011-00972-03 WITH S/N: 88900245 AND INSTALLED OVERHAULED EXCHANGE GDU 1040 WITH S/N: 88900615.</p> <p><i>[Signature]</i> 5/12/08                  Signed STAN ERICKSON Date</p> <p>Install Flight Charts and Safe Taxi.                  Found Software version to not support Safe Taxi and Flight Charts.                  Uploaded ID tool 006-B0380-ZA-0A. Updated Software to GDU 8.10 version 534.09 in accordance with Cessna Service Bulletin SB08-34-05.                  Installed 010-00330-42 data cards in accordance with Cessna Service Bulletin SB08-34-07. All system operation normal.</p> <p>This aircraft has been repaired in accordance with current rules of the Federal Aviation Regulations and is approved for return to service. Pertinent details of the repair are on file at this repair station under Work Order No. W03231</p> <p>Signature <i>[Signature]</i> Date 3-11-09                  Sunrise Mountain Avionics                  2830 N. Rancho Dr., Suite A                  Las Vegas, Nv. 89130                  Repair Station SMCR379X</p>